

1



भारत सरकार GOVERNMENT OF INDIA
खान मंत्रालय MINISTRY OF MINES
भारतीय खान ब्यूरो INDIAN BUREAU OF MINES
क्षेत्रीय खान नियंत्रक के कार्यालय
OFFICE OF THE REGIONAL
CONTROLLER OF MINES



BY REGD POST A/

D

Phone: 0674-2352463

Tele Fax: 0674-2352490

E-mail:

ro.bhubaneshwar@ibm.gov.in

Plot No.149, Pokhariput
BHUBANESWAR-751020

दिनांक -

05/12/2024

प्रेषिति-

Shri दिलीप ओमन, नोमीनटेड ओनर
M/s Arcelor Mittal Nippon Steel India limited.
27 KM,SURAT HAZIRA ROAD, HAZIRA,
SURAT, GUJARAT CHOURASI
Email:dilip.oommen@amns.in,

विषय- ओडिशा राज्य के सुंदरगढ़ जिले में स्थित आपकी घोरबुरहानी सगासाही लौह अयस्क खदान 139.165 हे० में खनिज संरक्षण एवं विकास नियमावली 2017 के नियमों के उल्लंघन के संबंध में-

महोदय

The following provisions of Mineral Conservation and Development Rules, 2017 were found violated during inspection of the above mine on 08.11.2024 by undersigned accompanied by Shri Satyakama Das, Manager Mines & Shri Chandrabhanu Das, QP.

Rule	Nature of Violation observed
11(1)	Mining operations should have been undertaken in accordance with the Mining Plan/ Review of Mining Plan. The Review of Mining Plan was approved vide letter no. MPM/A/25-ORI/BHU/ 2021-22, Dtd. 15.02.2022 and following deviation was observed during inspection 1. During mine visit it was observed that that bench parameters are not as per proposal. The benches not developed as per proposal. The maximum height of bench was proposed 10 meter and minimum width 10 meter but bench height in many places 12-15 meter and width also less than proposal. The bench height in many places in south quarry more than 15 meter. There are many places where undercuts in benches, overhang boulder observed. 2. The mineral also stacked at the edge of the benches mostly in North quarry as reflected in surface plan. 3. The bench height of Dump-2 & Dump-1 proposed 7.70 meter & 13.36 meter respectively but actual bench height is more than 20 meter. 4. The OB generation as development proposed 1177520 m3 but actual OB generation reported 240491m3 which is only 20% of the proposal.
37(2)	The OB dump shall be properly secured to prevent escape of material there from in harmful quantities which may cause degradation of environment and to prevent causation of floods. It was observed that there is no proper terracing and dump height is more than 20 meter (Dump-1) and it is near to the lease boundary between BP-1 to BP-2 but still no proper retaining wall is constructed nor any control measures for dump stability taken.
45(5)(c)	While scrutiny of Annual returns'24 few discrepancies observed 1. It was observed the ex-mine price of fines of 55-58% FE is more than the fines of 58-60% FE The Ex-mine price of 55-58% Fe fines is Rs 3069.47 /ton whereas 58-60% Fe fines Rs 2760.00/ton. 2. The Ex-mine price of the material used for captive use should be mentioned as per Rule in Part-IV.

- 2 इस संदर्भ में आपका ध्यान आकर्षित किया जाता है कि उपरोक्त नियमों का उल्लंघन खनिज संरक्षण एवं विकास नियमावली 2017 के नियम 62 के अंतर्गत दंडनीय अपराध है। एवम इस नियम का उल्लंघन की अनुपालना नहीं होने पर खनिज संरक्षण एवं विकास नियमावली 2017 के नियम 11(2) एवम 45(7)(क) के अंतर्गत
(क) खान की सारी खनन संक्रियाएं बंद की जा सकती हैं।
(ख) आपके विरुद्ध अभियोग दायर किया जा सकता है।
(ग) खनन पट्टे को निरस्त करने की सिफारिस राज्य सरकार से की जा सकती है।
- 3 अतः आपको सलाह दी जाती है कि आप उपरोक्त उल्लंघनों का अतिशिघ्र सुधार करें एवम इसके सुधार की सूचना इस पत्र के जारी होने से 45 दिन के भीतर इस कार्यालय को सूचित करें।

भवदीय

(राजेश कुमार दास)
उप खान नियंत्रक
भारतीय खान ब्यूरो, भुवनेश्वर

Copy forwarded for kind information to:

- (1) The Director of Mines, Directorate of Mines, Government of Odisha, Heads of Department Building, Bhubaneswar-751 001
- (2) The Controller of Mines (EZ), Indian Bureau of Mines, CP-13, Sector V Salt Lake City, Kolkata- 700 091.

(राजेश कुमार दास)
उप खान नियंत्रक
भारतीय खान ब्यूरो, भुवनेश्वर