

1



भारत सरकार GOVERNMENT OF INDIA
खान मंत्रालय MINISTRY OF MINES
भारतीय खान ब्यूरो INDIAN BUREAU OF MINES
क्षेत्रीय खान नियंत्रक के कार्यालय
OFFICE OF THE REGIONAL CONTROLLER OF MINES

**BY REGD POST A/****D**

Phone: 0674-2352463

Tele Fax: 0674-2352490

E-mail:

ro.bhubaneshwar@ibm.gov.in

Plot No.149, Pokhariput
BHUBANESWAR-751020

दिनांक -

04/12/2024

प्रेषिति- श्री सौरव मिश्रा, नोमीनटेड ओनर
M/s घनश्याम मिश्रा एंड संस (पी) लिमिटेड.
JBS Road, Silver Spring, Kolkata
Email:sourav.misra@gmail.com,

विषय- ओडिशा राज्य के मयूरभंज जिले में स्थित आपकी गोरुमहिसानी लौह अयस्क खदानखदान 349.50 हे० में खनिज संरक्षण एवं विकास नियमावली 2017 के नियमों के उल्लंघन के संबंध में-

महोदय

The following provisions of Mineral Conservation and Development Rules, 2017 were found violated during inspection of the above mine on 05.11.2024 by undersigned accompanied by Shri Anubhab Dutta(Mine Manager) & Shri Kshiti Ranjan Ray, QP.

Rule	Nature of Violation observed
11(1)	Mining operations should have been undertaken in accordance with the Mining Plan/ Review of Mining Plan. The Modified Mining Plan was approved vide letter no. MCDR-MiFLOFE/18/2022-BBS-IBM_RO_BBS dated 01.12.2023 and following deviation was observed during inspection 1. During mine visit it was observed that that bench parameters are not as per proposal. The benches not developed as per proposal. The maximum height of bench was proposed 6.5 meter and minimum width 9 meter but bench height in many places in both the pits(Kochar pit between ML-C51 to ML-C52 & F-Level pit between ML-C2 to ML-C3) 15-20 meter and width also less than proposal. There are many places where undercuts in benches, overhang boulder observed. The mineral also stacked at the edge of the benches. 2. The production proposal was given in two pits but mostly production is done from F-level pit. 3. The dumping is not as per proposal and mostly done in inclined dump. 4. The mineral reject generation proposal was nil for 2023-24 but as per annual return'24 Mineral reject generation was from unprocessed ore 394409.40 tons & from processed ore 313253.00.
37(2)	The OB dump shall be properly secured to prevent escape of material there from in harmful quantities which may cause degradation of environment and to prevent causation of floods. It was observed that there is no proper terracing and dump height is more than 30 meter (Rajpal Dump. Inclined dump,KTD1 &D2) but still no proper retaining wall is constructed nor any control measures for dump stability taken.
45(5)(c)	While scrutiny of Annual returns'24 few discrepancies observed 1. It was observed the information regarding OB is different in AR'24 and star rating template'24. 2. As per AR'24 PART-VII: COST OF PRODUCTION it was 11.44 rs considered for cost of production but in actually no exploration done..

- 2 इस संदर्भ में आपका ध्यान आकर्षित किया जाता है कि उपरोक्त नियमों का उल्लंघन खनिज संरक्षण एवं विकास नियमावली 2017 के नियम 62 के अंतर्गत दंडनीय अपराध है। एवम इस नियम का उल्लंघन की अनुपालना नहीं होने पर खनिज संरक्षण एवं विकास नियमावली 2017 के नियम 11(2) एवम 45(7)(क) के अंतर्गत
(क) खान की सारी खनन संक्रियाएं बंद की जा सकती है।
(ख) आपके विरुद्ध अभियोग दायर किया जा सकता है।
(ग) खनन पट्टे को निरस्त करने की सिफारिस राज्य सरकार से की जा सकती है।
- 3 अतः आपको सलाह दी जाती है कि आप उपरोक्त उल्लंघनों का अतिशिघ्र सुधार करें एवम इसके सुधार की सूचना इस पत्र के जारी होने से 45 दिन के भीतर इस कार्यालय को सूचित करें।

भवदीय

(राजेश कुमार दास)
उप खान नियंत्रक
भारतीय खान ब्यूरो, भुवनेश्वर

Copy forwarded for kind information to:

- (1) The Director of Mines, Directorate of Mines, Government of Odisha, Heads of Department Building, Bhubaneswar-751 001
- (2) The Controller of Mines (EZ), Indian Bureau of Mines, CP-13, Sector V Salt Lake City, Kolkata- 700 091.

(राजेश कुमार दास)
उप खान नियंत्रक
भारतीय खान ब्यूरो, भुवनेश्वर